

Date: 24 January 2007

Mandatory Service Bulletin No: B06-01

Subject: Cylinder assembly recall due to head cracking. Superior Part numbers SA47000L-A1, SA47000L-A20P, SA47000S-A1, SA47000S-A20P, SA47000S-A21P, SA52000- A1, SA52000-A20P, SA52000-A21P, SA52000-A22P, SA52000-A23P, SA55000-A1, SA55000-A20P
SL32000W-A1, SL32000W-A20P, SL32000W-A21P, SL32000WH-A1, SL32000WH-A20P, SL32006W-A1, SL32006W-A20P, SL32006W-A21P, SL36000TW-A1, SL36000TW-A20P, SL36000TW-A21P, SL36000TW-A22P, SL36000W-A1, SL36000W-A20P, SL36000W-A21P, SL36006W-A1, SL36006W-A20P, SL36006W-A21P

Engine Applications: Teledyne Continental Motors Engines:

O-470-G, -K, -L, -M, -P, -R, -S, -U IO-470-C, -D, -E, -F, -G, -H, -L, -M, -N, -P, -R, -S, -U, -V

IO-520-A, -B, -BA, -C, -D, -E, -F, -J, -K, -L, -M, -BB, -CB, -MB.

TSIO-520-AF, -B, -BB, -C, -CE, -D, -DB, -E, -EB, -G, -H, -J, -JB, -K, -KB, -L, -LB, -M, -N, -NB, -P, -R, -T, UB, -VB, -WB

IO-550-A, -B, -C, -D, -E, -F, -L

Textron Lycoming Engines:

O-320-A, -B, -C, -D, -E, -H IO-320-B, -D, -E LIO-320-B AIO-320-A, -B, -C AEIO-320-D, -E

O-360-A, -B, -C, -D, -F, -G, -J IO-360-B, -L, -M LO-360-A AEIO-360-B, -H HO-360-C HIO-360-B

O-540-A, -B, -E, -F, -G, -H, -J, IO-540-A, -C, -D, -N, -T, -V, -W AEIO-540-D

Superior Air Parts, Inc. Engines:

Vantage Engine ® O-360-A

XP360 Engine ® (Experimental) O-360-A, B IO-360-A,B

Issue:

Superior Air Parts, Inc. (Superior) has discovered that cylinder assemblies identified in this Service Bulletin were manufactured from cylinder barrels that were not properly hardened to specification. The soft cylinder barrels may result in fatigue cracking of the cylinder head. The propagation of this crack may lead to head / barrel separation and loss of power in flight. This bulletin requires the removal of Superior cylinder assemblies with the serial numbers listed in this Service Bulletin. These affected serial numbers were manufactured between April and November 2005.

The E revision of this Service Bulletin revises the serial numbers affected and added Superior Air Parts, Inc. engines. If the serial numbers were previously checked to Revision D, they must be rechecked under Revision E. If the serial numbers were checked on Superior's website and appropriate contact information was provided, then notification will be provided by the website for the changes that are the subject of this revision.

Time of Compliance:

Removal from service must be accomplished before the affected cylinder attains 150 hours time in service. If cylinders have exceeded 150 hours, they must be replaced within the next ten hours of operation.

Procedure:

If you have an affected cylinder(s) or need to determine if your cylinder(s) are affected, go to Superior's website www.superiorairparts.com/SB0601 and complete recall Form TSF 005 online. In order to complete the form you should have the cylinder part number(s), serial number(s) and time in service readily available. Once all required information is submitted, you will receive an automatic notification as to whether your cylinders are affected. If affected, you will be contacted by a Superior representative within three (3) business days for instructions on replacement of your cylinders.

Replacement cylinders will be sent in accordance with Superior's warranty policy and replacement coverage will be handled through Superior's warranty policy. If you have any questions, you may either email us at SB0601@superiorairparts.com or call the SB0601 hotline at 972-829-4617.

Note: Superior reserves the right to replace cylinders with either our Standard Cast® or Investment Cast cylinders.


The cylinders are identified by part number and serial number on the cylinder flange, as shown in Figure 1.



Figure 1.

Serial Number Breakdown

It is important to provide the entire cylinder assembly serial number when complying with this bulletin. The serial number detail will provide Superior additional information with tracking the affected lots and date range. The following is a breakdown of the serial number listed in the above picture:

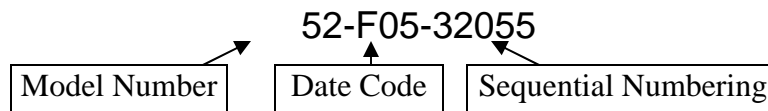

Note: Serial numbers may or may not have hyphens. The serial numbers may be entered in the recall form with or without hyphens.

Labor Allowance:

Superior shall reimburse the following labor allowances for the removal and installation of the affected cylinder assemblies.

First cylinder change on either side.

O/IO-470 IO-520/550 – 6 hours

TSIO-520 – 8 hours

O/IO-320/360 – 6 hours

O/IO-540 – 6 hours

Second or third cylinder on same side add:

O/IO-470 IO-520/550 – 4 hours

TSIO-520 – 5 hours

O/IO-320/360 – 3 hours

O/IO-540 – 3 hours

Freight Allowance:

Superior will reimburse for surface freight only. No air or express freight will be covered.

Conditions:

Superior Air Parts, Inc. will not reimburse claims submitted for researching for recalled cylinders.

All conditions stated in the Superior Air Parts warranty policy will apply.

Replacement under warranty including labor and freight allowance will only be available for cylinders registered 60 (Sixty) days from the issuance date of this Service Bulletin.

Serial Numbers by Part Number

SA47000L-A1 SA47000L-A20P

47LE053559	47LE053574	47LE053589	47LE053604	47LF053619	47LF053634	
47LE053560	47LE053575	47LE053590	47LE053605	47LF053620	47LF053635	
47LE053561	47LE053576	47LE053591	47LE053606	47LF053621	47LF053636	
47LE053562	47LE053577	47LE053592	47LE053607	47LF053622	47LF053637	
47LE053563	47LE053578	47LE053593	47LE053608	47LF053623	47LF053638	
47LE053564	47LE053579	47LE053594	47LF053609	47LF053624	47LF053639	
47LE053565	47LE053580	47LE053595	47LF053610	47LF053625	47LF053640	
47LE053566	47LE053581	47LE053596	47LF053611	47LF053626	47LF053641	
47LE053567	47LE053582	47LE053597	47LF053612	47LF053627	47LF053642	
47LE053568	47LE053583	47LE053598	47LE053613	47LF053628	47LF053643	
47LE053569	47LE053584	47LE053599	47LF053614	47LF053629		
47LE053570	47LE053585	47LE053600	47LF053615	47LF053630		
47LE053571	47LE053586	47LE053601	47LF053616	47LF053631		
47LE053572	47LE053587	47LE053602	47LF053617	47LF053632		
47LE053573	47LE053588	47LE053603	47LF053618	47LF053633		

SA47000S-A1 SA47000S-A20P SA47000S-A21P

47SE054212	47SE054219	47SE054226	47SE054233	47SF054240	47SF054247
47SE054213	47SE054220	47SE054227	47SE054234	47SF054241	47SF054248
47SE054214	47SE054221	47SE054228	47SE054235	47SF054242	47SF054249
47SE054215	47SE054222	47SE054229	47SF054236	47SF054243	47SF054250
47SE054216	47SE054223	47SE054230	47SF054237	47SF054244	47SF054251
47SE054217	47SE054224	47SE054231	47SF054238	47SF054245	
47SE054218	47SE054225	47SE054232	47SF054239	47SF054246	

SA52000-A1 SA52000-A20P SA52000-A21P SA52000-A22P SA52000-A23P

52D0531708	52D0531778	52E0531848	52E0531920	52F0531990	52F0532060	52H0532130
52D0531709	52D0531779	52E0531849	52E0531921	52F0531991	52F0532061	52H0532131
52D0531710	52D0531780	52E0531850	52E0531922	52F0531992	52F0532062	52H0532132
52D0531711	52D0531781	52E0531851	52E0531923	52F0531993	52F0532063	52H0532133
52D0531712	52D0531782	52E0531852	52E0531924	52F0531994	52F0532064	52H0532134
52D0531713	52D0531783	52E0531853	52E0531925	52F0531995	52F0532065	52H0532135
52D0531714	52D0531784	52E0531854	52E0531926	52F0531996	52F0532066	52H0532136
52D0531715	52D0531785	52E0531855	52E0531927	52F0531997	52F0532067	52H0532137
52D0531716	52D0531786	52E0531856	52E0531928	52F0531998	52F0532068	52H0532138
52D0531717	52D0531787	52E0531857	52E0531929	52F0531999	52F0532069	52H0532139
52D0531718	52D0531788	52E0531858	52E0531930	52F0532000	52F0532070	52H0532140
52D0531719	52D0531789	52E0531859	52E0531931	52F0532001	52F0532071	52H0532141
52D0531720	52D0531790	52E0531860	52E0531932	52F0532002	52F0532072	52H0532142
52D0531721	52D0531791	52E0531861	52E0531933	52F0532003	52F0532073	52H0532143
52D0531722	52D0531792	52E0531862	52E0531934	52F0532004	52F0532074	52H0532144

52D0531723	52D0531793	52E0531863	52E0531935	52F0532005	52F0532075	52H0532145
52D0531724	52D0531794	52E0531864	52E0531936	52F0532006	52F0532076	52H0532146
52D0531725	52D0531795	52E0531865	52E0531937	52F0532007	52F0532077	52H0532147
52D0531726	52D0531796	52E0531866	52E0531938	52F0532008	52G0532078	52H0532148
52D0531727	52D0531797	52E0531867	52E0531939	52F0532009	52G0532079	52H0532149
52D0531728	52D0531798	52E0531868	52E0531940	52F0532010	52G0532080	52H0532150
52D0531729	52D0531799	52E0531869	52E0531941	52F0532011	52G0532081	52H0532151
52D0531730	52E0531800	52E0531870	52E0531942	52F0532012	52G0532082	52H0532152
52D0531731	52E0531801	52E0531871	52E0531943	52F0532013	52G0532083	52H0532153
52D0531732	52E0531802	52E0531872	52F0531944	52F0532014	52G0532084	52H0532154
52D0531733	52E0531803	52E0531873	52F0531945	52F0532015	52G0532085	52H0532155
52D0531734	52E0531804	52E0531874	52F0531946	52F0532016	52G0532086	52H0532156
52D0531735	52E0531805	52E0531877	52F0531947	52F0532017	52G0532087	52H0532157
52D0531736	52E0531806	52E0531878	52F0531948	52F0532018	52G0532088	52H0532158
52D0531737	52E0531807	52E0531879	52F0531949	52F0532019	52G0532089	52H0532159
52D0531738	52E0531808	52E0531880	52F0531950	52F0532020	52G0532090	52H0532160
52D0531739	52E0531809	52E0531881	52F0531951	52F0532021	52G0532091	52H0532161
52D0531740	52E0531810	52E0531882	52F0531952	52F0532022	52G0532092	52H0532162
52D0531741	52E0531811	52E0531883	52F0531953	52F0532023	52G0532093	52H0532163
52D0531742	52E0531812	52E0531884	52F0531954	52F0532024	52G0532094	52H0532164
52D0531743	52E0531813	52E0531885	52F0531955	52F0532025	52G0532095	52H0532165
52D0531744	52E0531814	52E0531886	52F0531956	52F0532026	52G0532096	52H0532166
52D0531745	52E0531815	52E0531887	52F0531957	52F0532027	52G0532097	52H0532167
52D0531746	52E0531816	52E0531888	52F0531958	52F0532028	52G0532098	52H0532168
52D0531747	52E0531817	52E0531889	52F0531959	52F0532029	52G0532099	52H0532169
52D0531748	52E0531818	52E0531890	52F0531960	52F0532030	52G0532100	52H0532170
52D0531749	52E0531819	52E0531891	52F0531961	52F0532031	52G0532101	52H0532171
52D0531750	52E0531820	52E0531892	52F0531962	52F0532032	52G0532102	52H0532172
52D0531751	52E0531821	52E0531893	52F0531963	52F0532033	52G0532103	52H0532173
52D0531752	52E0531822	52E0531894	52F0531964	52F0532034	52G0532104	52H0532174
52D0531753	52E0531823	52E0531895	52F0531965	52F0532035	52G0532105	52H0532175
52D0531754	52E0531824	52E0531896	52F0531966	52F0532036	52G0532106	52H0532176
52D0531755	52E0531825	52E0531897	52F0531967	52F0532037	52G0532107	52H0532177
52D0531756	52E0531826	52E0531898	52F0531968	52F0532038	52G0532108	52H0532178
52D0531757	52E0531827	52E0531899	52F0531969	52F0532039	52G0532109	52H0532179
52D0531758	52E0531828	52E0531900	52F0531970	52F0532040	52G0532110	52H0532180
52D0531759	52E0531829	52E0531901	52F0531971	52F0532041	52G0532111	52H0532181
52D0531760	52E0531830	52E0531902	52F0531972	52F0532042	52G0532112	52H0532182
52D0531761	52E0531831	52E0531903	52F0531973	52F0532043	52G0532113	52H0532183
52D0531762	52E0531832	52E0531904	52F0531974	52F0532044	52G0532114	52H0532184
52D0531763	52E0531833	52E0531905	52F0531975	52F0532045	52G0532115	52H0532185
52D0531764	52E0531834	52E0531906	52F0531976	52F0532046	52G0532116	52H0532186
52D0531765	52E0531835	52E0531907	52F0531977	52F0532047	52G0532117	52H0532187
52D0531766	52E0531836	52E0531908	52F0531978	52F0532048	52G0532118	52H0532188
52D0531767	52E0531837	52E0531909	52F0531979	52F0532049	52G0532119	52H0532189

52D0531768	52E0531838	52E0531910	52F0531980	52F0532050	52G0532120	52H0532190
52D0531769	52E0531839	52E0531911	52F0531981	52F0532051	52G0532121	52H0532191
52D0531770	52E0531840	52E0531912	52F0531982	52F0532052	52G0532122	52H0532192
52D0531771	52E0531841	52E0531913	52F0531983	52F0532053	52G0532123	52H0532193
52D0531772	52E0531842	52E0531914	52F0531984	52F0532054	52G0532124	52H0532194
52D0531773	52E0531843	52E0531915	52F0531985	52F0532055	52G0532125	52H0532195
52D0531774	52E0531844	52E0531916	52F0531986	52F0532056	52G0532126	52H0532196
52D0531775	52E0531845	52E0531917	52F0531987	52F0532057	52G0532127	52H0532197
52D0531776	52E0531846	52E0531918	52F0531988	52F0532058	52G0532128	
52D0531777	52E0531847	52E0531919	52F0531989	52F0532059	52G0532129	

SA55000-A1 SA55000-A20P

55E05223	55E05233	55E05243	55G05253	55G05263	55G05273	55G05284
55E05224	55E05234	55E05244	55G05254	55G05264	55G05274	55G05285
55E05225	55E05235	55E05245	55G05255	55G05265	55G05275	55G05286
55E05226	55E05236	55E05246	55G05256	55G05266	55G05276	55G05287
55E05227	55E05237	55E05247	55G05257	55G05267	55G05278	55G05288
55E05228	55E05238	55G05248	55G05258	55G05268	55G05279	55G05289
55E05229	55E05239	55G05249	55G05259	55G05269	55G05280	
55E05230	55E05240	55G05250	55G05260	55G05270	55G05281	
55E05231	55E05241	55G05251	55G05261	55G05271	55G05282	
55E05232	55E05242	55G05252	55G05262	55G05272	55G05283	

SL32000W-A1 SL32000W-A20P SL32000W-A21P

32WE059006	32WE059015	32WE059024	32WF059033	32WF059042	32WF059051	32WF059060
32WE059007	32WE059016	32WE059025	32WF059034	32WF059043	32WF059052	32WF059061
32WE059008	32WE059017	32WF059026	32WF059035	32WF059044	32WF059053	32WF059062
32WE059009	32WE059018	32WF059027	32WF059036	32WF059045	32WF059054	32WF059063
32WE059010	32WE059019	32WF059028	32WF059037	32WF059046	32WF059055	32WF059064
32WE059011	32WE059020	32WF059029	32WF059038	32WF059047	32WF059056	32WF059065
32WE059012	32WE059021	32WF059030	32WF059039	32WF059048	32WF059057	32WF059066
32WE059013	32WE059022	32WF059031	32WF059040	32WF059049	32WF059058	32WF059067
32WE059014	32WE059023	32WF059032	32WF059041	32WF059050	32WF059059	

SL32000WH-A1 SL32000WH-A20P

32WHE05379	32WHE05381	32WHE05383	32WHE05385	32WHE05387	32WHE05389	32WHE05391
32WHE05380	32WHE05382	32WHE05384	32WHE05386	32WHE05388	32WHE05390	32WHE05392

SL32006W-A1 SL32006W-A20P SL32006W-A21P

326WF055517	326WF055520	326WF055523	326WF055526	326WF055529	326WF055532	
326WF055518	326WF055521	326WF055524	326WF055527	326WF055530		
326WF055519	326WF055522	326WF055525	326WF055528	326WF055531		

SL36000TW-A1 SL36000TW-A20P SL36000TW-A21P SL36000TW-A22P

36TWF05430	36TWF05434	36TWF05438	36TWF05442	36TWF05446	36TWF05450	
36TWF05431	36TWF05435	36TWF05439	36TWF05443	36TWF05447	36TWF05451	
36TWF05432	36TWF05436	36TWF05440	36TWF05444	36TWF05448	36TWF05452	
36TWF05433	36TWF05437	36TWF05441	36TWF05445	36TWF05449	36TWG05453	

SL36000W-A1 SL36000W-A20P SL36000W-A21P

36WF058058	36WF058068	36WF058078	36WF058088	36WF058098	36WG058108	36WG058119
36WF058059	36WF058069	36WF058079	36WF058089	36WF058099	36WG058109	36WG058120
36WF058060	36WF058070	36WF058080	36WF058090	36WG058100	36WG058110	36WG058121
36WF058061	36WF058071	36WF058081	36WF058091	36WF058101	36WG058111	36WG058122
36WF058062	36WF058072	36WF058082	36WF058092	36WF058102	36WG058112	36WG058123
36WF058063	36WF058073	36WF058083	36WF058093	36WF058103	36WG058113	36WG058124
36WF058064	36WF058074	36WF058084	36WF058094	36WF058104	36WG058114	36WJ058181
36WF058065	36WF058075	36WF058085	36WF058095	36WF058105	36WG058115	36WJ058182
36WF058066	36WF058076	36WF058086	36WF058096	36WG058106	36WG058117	
36WF058067	36WF058077	36WF058087	36WF058097	36WG058107	36WG058118	

SL36006W-A1 SL36006W-A20P SL36006W-A21P

366WE056944	366WF057016	366WF057176	366WF057274	366WF057346	366WG057418	366WG057490
366WE056945	366WF057017	366WF057177	366WF057275	366WF057347	366WG057419	366WG057491
366WE056946	366WF057018	366WF057178	366WF057276	366WF057348	366WG057420	366WG057492
366WE056947	366WF057019	366WF057179	366WF057277	366WF057349	366WG057421	366WG057493
366WE056948	366WF057020	366WF057180	366WF057278	366WF057350	366WG057422	366WG057494
366WE056949	366WF057021	366WF057181	366WF057279	366WF057351	366WG057423	366WG057495
366WE056950	366WF057022	366WF057182	366WF057280	366WF057352	366WG057424	366WG057496
366WE056951	366WF057023	366WF057183	366WF057281	366WF057353	366WG057425	366WG057497
366WE056952	366WF057024	366WF057184	366WF057282	366WF057354	366WG057426	366WG057498
366WE056953	366WF057025	366WF057185	366WF057283	366WF057355	366WG057427	366WG057499
366WE056954	366WF057026	366WF057186	366WF057284	366WF057356	366WG057428	366WG057500
366WE056955	366WF057027	366WF057187	366WF057285	366WF057357	366WG057429	366WG057501
366WE056956	366WF057028	366WF057188	366WF057286	366WF057358	366WG057430	366WG057502
366WE056957	366WF057029	366WF057189	366WF057287	366WF057359	366WG057431	366WG057503
366WE056958	366WF057030	366WF057190	366WF057288	366WF057360	366WG057432	366WG057504
366WE056959	366WF057031	366WF057191	366WF057289	366WF057361	366WG057433	366WG057505
366WF056960	366WF057032	366WF057192	366WF057290	366WF057362	366WG057434	366WG057506
366WF056961	366WF057033	366WF057193	366WF057291	366WF057363	366WG057435	366WG057507
366WF056962	366WF057034	366WF057194	366WF057292	366WF057364	366WG057436	366WG057508
366WF056963	366WF057035	366WF057195	366WF057293	366WF057365	366WG057437	366WG057509
366WF056964	366WF057036	366WF057196	366WF057294	366WF057366	366WG057438	366WG057510
366WF056965	366WF057037	366WF057197	366WF057295	366WF057367	366WG057439	366WG057511
366WF056966	366WF057038	366WF057198	366WF057296	366WF057368	366WG057440	366WG057512
366WF056967	366WF057039	366WF057199	366WF057297	366WF057369	366WG057441	366WG057513
366WF056968	366WF057040	366WF057200	366WF057298	366WF057370	366WG057442	366WG057514
366WF056969	366WF057041	366WF057201	366WF057299	366WF057371	366WG057443	366WG057515
366WF056970	366WF057042	366WF057202	366WF057300	366WF057372	366WG057444	366WG057516

366WF056971	366WF057043	366WF057203	366WF057301	366WF057373	366WG057445	366WG057517
366WF056972	366WF057044	366WF057204	366WF057302	366WF057374	366WG057446	366WG057518
366WF056973	366WF057045	366WF057205	366WF057303	366WF057375	366WG057447	366WG057519
366WF056974	366WF057046	366WF057206	366WF057304	366WF057376	366WG057448	366WG057520
366WF056975	366WF057047	366WF057207	366WF057305	366WF057377	366WG057449	366WG057521
366WF056976	366WF057048	366WF057208	366WF057306	366WF057378	366WG057450	366WG057522
366WF056977	366WF057049	366WF057209	366WF057307	366WF057379	366WG057451	366WG057523
366WF056978	366WF057050	366WF057210	366WF057308	366WF057380	366WG057452	366WG057524
366WF056979	366WF057051	366WF057211	366WF057309	366WF057381	366WG057453	366WG057525
366WF056980	366WF057052	366WF057212	366WF057310	366WF057382	366WG057454	366WG057526
366WF056981	366WF057053	366WF057213	366WF057311	366WF057383	366WG057455	366WG057527
366WF056982	366WF057054	366WF057214	366WF057312	366WF057384	366WG057456	366WG057528
366WF056983	366WF057055	366WF057215	366WF057313	366WF057385	366WG057457	366WG057529
366WF056984	366WF057056	366WF057216	366WF057314	366WF057386	366WG057458	366WG057530
366WF056985	366WF057057	366WF057217	366WF057315	366WF057387	366WG057459	366WG057531
366WF056986	366WF057058	366WF057218	366WF057316	366WG057388	366WG057460	366WG057532
366WF056987	366WF057059	366WF057219	366WF057317	366WG057389	366WG057461	366WG057533
366WF056988	366WF057060	366WF057220	366WF057318	366WG057390	366WG057462	366WG057534
366WF056989	366WF057061	366WF057221	366WF057319	366WG057391	366WG057463	366WG057535
366WF056990	366WF057150	366WF057222	366WF057320	366WG057392	366WG057464	366WG057536
366WF056991	366WF057151	366WF057223	366WF057321	366WG057393	366WG057465	366WG057537
366WF056992	366WF057152	366WF057224	366WF057322	366WG057394	366WG057466	366WG057538
366WF056993	366WF057153	366WF057225	366WF057323	366WG057395	366WG057467	366WG057539
366WF056994	366WF057154	366WF057226	366WF057324	366WG057396	366WG057468	366WG057540
366WF056995	366WF057155	366WF057227	366WF057325	366WG057397	366WG057469	366WJ057770
366WF056996	366WF057156	366WF057228	366WF057326	366WG057398	366WG057470	366WJ057771
366WF056997	366WF057157	366WF057229	366WF057327	366WG057399	366WG057471	366WJ057772
366WF056998	366WF057158	366WF057230	366WF057328	366WG057400	366WG057472	366WJ057773
366WF056999	366WF057159	366WF057231	366WF057329	366WG057401	366WG057473	366WJ057774
366WF057000	366WF057160	366WF057232	366WF057330	366WG057402	366WG057474	366WJ057775
366WF057001	366WF057161	366WF057259	366WF057331	366WG057403	366WG057475	366WJ057776
366WF057002	366WF057162	366WF057260	366WF057332	366WG057404	366WG057476	366WL058131
366WF057003	366WF057163	366WF057261	366WF057333	366WG057405	366WG057477	
366WF057004	366WF057164	366WF057262	366WF057334	366WG057406	366WG057478	
366WF057005	366WF057165	366WF057263	366WF057335	366WG057407	366WG057479	
366WF057006	366WF057166	366WF057264	366WF057336	366WG057408	366WG057480	
366WF057007	366WF057167	366WF057265	366WF057337	366WG057409	366WG057481	
366WF057008	366WF057168	366WF057266	366WF057338	366WG057410	366WG057482	
366WF057009	366WF057169	366WF057267	366WF057339	366WG057411	366WG057483	
366WF057010	366WF057170	366WF057268	366WF057340	366WG057412	366WG057484	
366WF057011	366WF057171	366WF057269	366WF057341	366WG057413	366WG057485	
366WF057012	366WF057172	366WF057270	366WF057342	366WG057414	366WG057486	
366WF057013	366WF057173	366WF057271	366WF057343	366WG057415	366WG057487	
366WF057014	366WF057174	366WF057272	366WF057344	366WG057416	366WG057488	
366WF057015	366WF057175	366WF057273	366WF057345	366WG057417	366WG057489	

Doc. Title: **Service Bulletin B06-01 Warranty Claims Form**
Form # TSF 005

Millennium Engine® Security Assurance Plan Number _____ Current Date: _____
Customer Number: _____ Date of Occurrence: _____

OWNER OR OPERATOR

REPAIR AGENCY

Name: _____ Name: _____
Address: _____ Address: _____
Phone #: _____ Phone #: _____
Email _____ Email _____
Contact: _____ Contact: _____

Customers description of difficulty: Compliance with Service Bulletin B06-01.

A/C Make/Model: _____ A/C Registration # _____
Engine Make/Model: _____ Engine Serial #: _____
Reported Primary Failed Part #: _____ Component Serial #: _____
Date Failed Part was Installed: _____ Total Time on Failed Part: _____

Part Number	Quantity	Description	Cost

SUB-TOTAL PARTS COST

Est Labor to Correct _____ Hours @ \$ _____ /Hour \$ _____
R & I Labor _____ Hours @ \$ _____ /Hour \$ _____
Outside Repairs\$ _____
Freight Cost\$ _____

TOTAL REPAIR COST \$

---Replaced Parts Claimed & Completed Claim Must Be Sent Together---